

# Technical Bulletin



Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta (A5)	2006, 2007	BRM	All	All	All

## Condition

10 07 02 June 29, 2007 2015162

### Engine Compartment, Noises

Rattling noises from engine compartment.

## Technical Background

Under certain driving conditions engine support mount bolts may loosen and cause engine compartment noises. Engine block fracture may occur.



### Note:

Engine block should not be replaced in the case of fracture. New engine support utilizes different mounting location.

## Production Solution


New support Part No. 03G199207G, cover Part No. 045109147A and mounting bolts Part No. -2- N10683301, and -1- N10655802.

# Technical Bulletin




## Service

Replace the support, Part No. 03G199207F, see Group 10 in ElsaWeb.

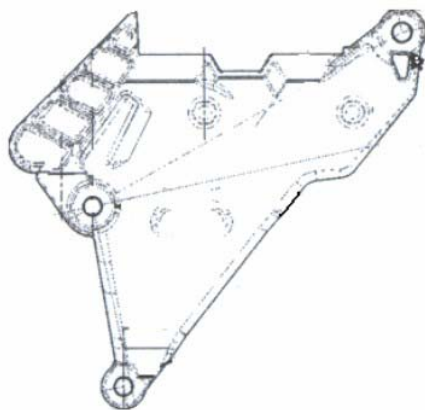

Verify that the support being replaced is old style support Part No. 03G199207F.

## Tightening Sequence

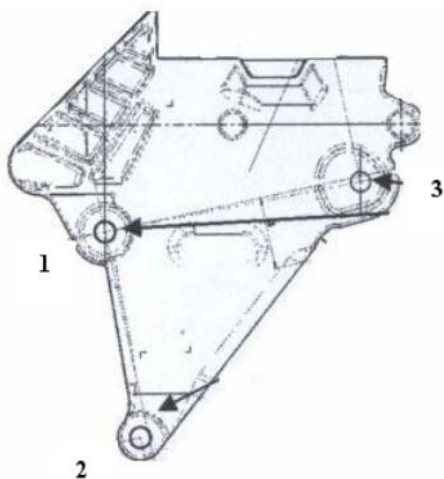

Tighten support bolts as follows:

- Torque 40 Nm + twice 90° in the sequence 1, 2, 3
- Alternatively 40 Nm + 180°



**Note:**

New bolts must be used.

# Technical Bulletin



## Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual	
Claim Type:	Use applicable Claim Type**
Part Identifier:	1031
Damage Code:	1031 10 __ _2*
Labor Operation:	10311999 = 190 TU
Diagnostic Time:	No Additional Diagnostic Time Allowed
Claim Comment: Input "As per Technical Bulletin 2015162" in comment section of Warranty Claim.	

\* Code per warranty vendor code policy.

\*\* Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only.

## Required Parts and Tools

Description	Part No:	Quantity
Support	03G199207G	1
Cover	045109147A	1
Hex. collar bolt	N10683301	2
Hex. collar bolt	N10655802	1

See Repair Manual for Special Tools required.

## Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.